 




Step 1. Slide the sub-components into the cable in the right order & orientation. (⚠ some elements are already mounted / hidden into the Body)




Step 2. Pull back shielding sleeve

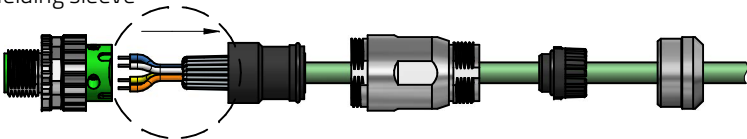


Step 3. Unscrew the screws and insert each wires into the right cavity. Then pre-assemble Sealing nut and Sealing clip on Body

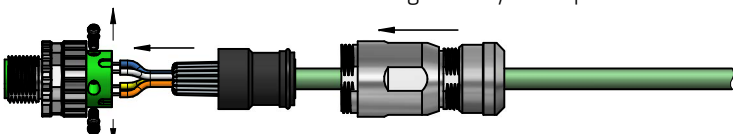


Step 4. Tighten the screws in order to hold the wires inside the cages. Recommended torque : 0.3 N.m

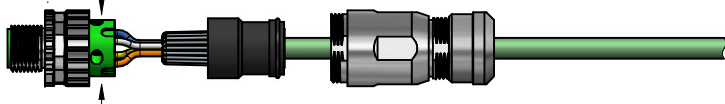


Step 5. Assemble Plastic Body with connecting part. It shall hide the wires and screws.

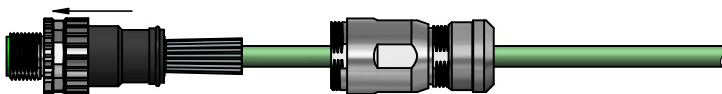


Step 6. Wrap the Plastic Body with the cable shielding.

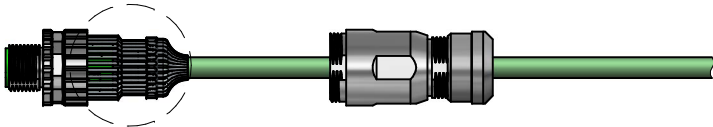


Step 7. Cut shielding according to the drawing.

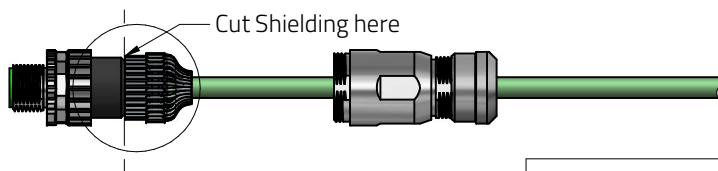

Step 8. Assemble all sub components together.

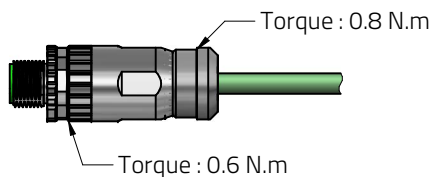


Recommended stripping lengths

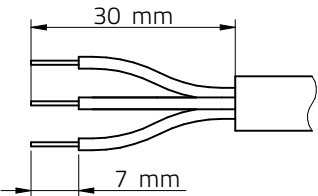


Seal & cable diameter

Sealing	Cable
4-6	Ø4-6mm
6-8	Ø6-8mm

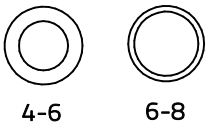

BOM

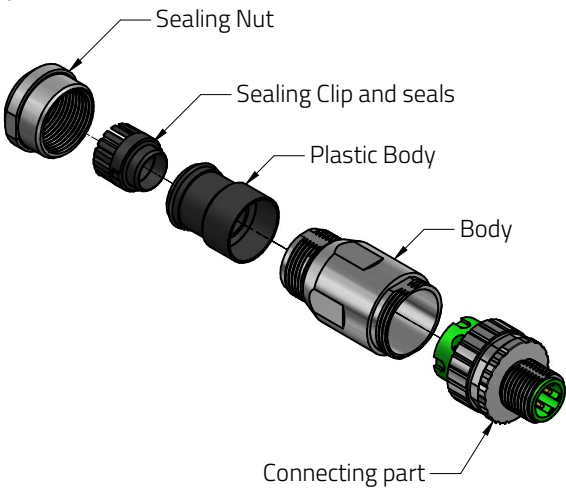

**WÜRTH
ELEKTRONIK**
MORE THAN
YOU EXPECT

Würth Elektronik eiSos GmbH & Co. KG
EMC & Inductive Solutions
Max-Eyth-Str. 1
74638 Waldenburg
Germany
Tel. +49 (0) 79 42 945 - 0
www.we-online.com
eiSos@we-online.com

CREATED
MDa

CHECKED
CPo

DESCRIPTION

Assembly instructions

643 852 200 204

REVISION
001.001

STATUS
Valid

DATE
26-02-23

BUSINESS UNIT
eiCan