



Step 1. Prepare connector components and strip coaxial cable according to given dimensions
(check point 1)

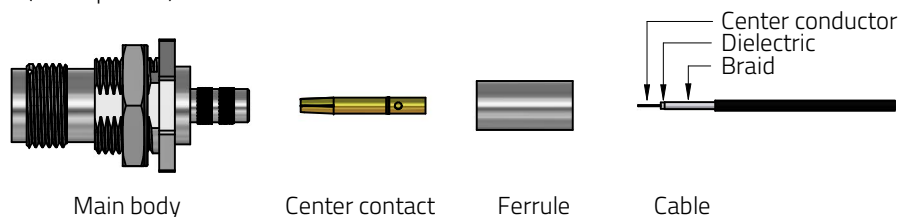


Step 2. Please slide ferrule onto cable and splay out cable braid

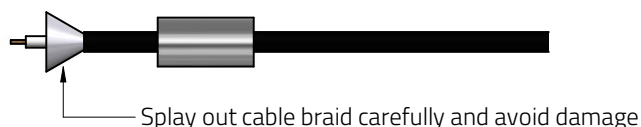


Step 3. Slide center contact up to dielectric and solder cable center conductor using minimum amount of solder paste through solder hole
(check point 2-3)



Step 4. Push cable with center contact into connector main body until perceptive point
Cover cable braid over connector neck carefully

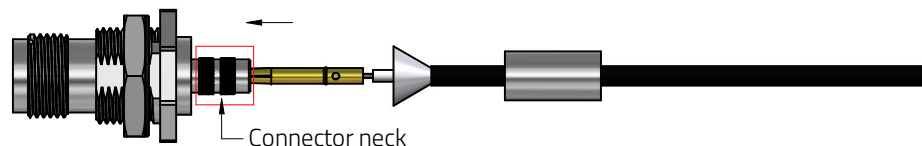

Step 5. Crimp ferrule with tool hex size : .213"

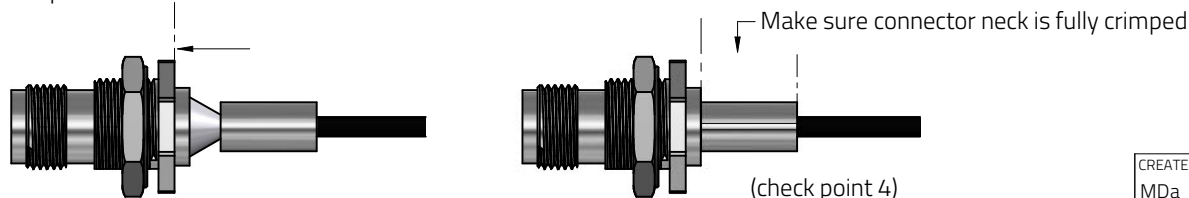

Assembly Method :

Center contact : Soldered
Outer contact : Crimp


Crimp Tool PN : 600600

Crimp Head PN : 60060060101




Cable Type : Flexible Cable RG58/RG141/Low Loss 195

Cable Strip Dimensions (mm) :

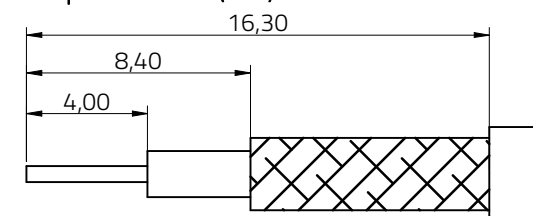

Check Point :

1. No damaged components; and no split cable after stripping
2. Assembly can be performed with or without tinned cable
The tinned cable center conductor can enhance the hardness of the cable center conductor and benefit solder process
3. No excess solder, melt dielectric, and misaligned center contact after assembling

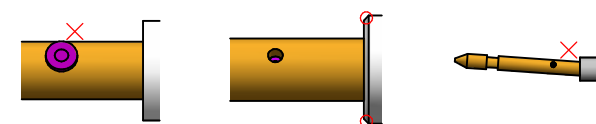

4. No significant dog ear after crimping



CREATED MDa	CHECKED JCh		
DESCRIPTION Assembly instructions 670 265 224 101 20			
REVISION 001.001	STATUS Valid	DATE 2025-04-18	BUSINESS UNIT eiCan



**WÜRTH
ELEKTRONIK**
MORE THAN
YOU EXPECT

Würth Elektronik eiSos GmbH & Co. KG
EMC & Inductive Solutions
Max-Eyth-Str. 1
74638 Waldenburg
Germany
Tel: +49 (0) 79 42 945 - 0
www.we-online.com
eiSos@we-online.com